

514 MECKLEM LANE, ELLWOOD CITY, PENNSYLVANIA 16117 PHONE: 724-752-2000 FAX: 724-758-1558 www.hallindustries.com E-mail: service@hallindustries.com



TB-980717 Equipment Manual

Serves the DC-9, MD-80 and 717 Aircraft

Use This Manual for

1. Operating Procedures

2. Maintenance Procedures

3. Tow Bar and Parts Ordering

For ordering new Tow Bars or Renewable Parts

Please contact: Penny Shirk

Hall Industries Equipment Division

One USS Industrial Park Ellwood City, PA 16117 Phone (724) 752-2000 FAX (724) 758-0753

"The Problem Solvers"

TB-980717 EQUIPMENT MANUAL

Description – Dimensions and Weights SECTION I

SECTION II Operating Procedures

Maintenance Procedures SECTION III

SECTION IV Renewal Parts

SECTION I DESCRIPTION – DIMENSIONS AND WEIGHTS

TB-980717 TOW BAR ASSEMBLY

Weight:

Body	135#
Yoke	120#
Tow Bar, COMPLETE	255#

Length:

Body with Tow Eye	124"
Head with Adapter	33"
Total Assembly	149"

Width:

Yoke 43"

Height:

Body 27" Yoke 14"



SECTION II OPERATING PROCEDURE

TB-980717 TOW BAR ASSEMBLY

A. ATTACHING TOW BAR TO AIRCRAFT

The DC 9, MD 80 and the 717 can be towed forward or pushed aft on hard surfaces using a yoke-type Tow Bar. The Tow Bar attaches to the nose wheel axle by means of the nose pins on the yoke. When the tow bar yoke is lined up with the nose gear, the nose pins have to be manually locked in position on both sides of the nose gear by the operator.

B. ATTACHING TOW BAR TO TOW TRACTOR

Once the tow bar is securely attached to the nose gear, the tow tractor should be placed at the centerline of the Tow Bar. The operator must manually lift the tow bar to engage with the tow tractor and install the locking pin.

C. PUSHING THE AIRCRAFT

This must be done in accordance with the instructions in the Boeing or McDonnell Douglas Facility and Equipment Planning Manuals.

CAUTION: If at any time the shear bolt yields or breaks, carefully bring the aircraft to a stop. Before pushing or tow can be continued a new shear bolt must be inserted. Use only a Hall Industries shear bolt as follows, Part Number TB-980717-2.

D. DISCONNECTING TOW BAR FROM AIRCRAFT

Release the nose pins manually allowing the release of the yoke from the nose gear on the aircraft. Carefully move the tow bar and tow tractor clear of the aircraft.

SECTION III MAINTENANCE PROCEDURES TB-980717 TOW BAR ASSEMBLY

- A. Inspect all Hardware.
- B. Check wheels and wheel carriage for bent, broken, or worn parts.
- C. Check for proper tire pressure. Correct pressure is 40 psi (maximum psi is 50).
- D. Lubricate wheels. There is a grease fitting on each wheel that requires lubrication each time you complete your scheduled maintenance, not to exceed 6 months.
- E. Lubricate the grease fittings (two sides) on the nose pin body each time you complete your scheduled maintenance, not to exceed 6 months.
- F. Check yoke assembly for operation of locking mechanism. Check the latch pin on the locking mechanism to insure it engages properly. There is an adjustable setscrew on the aluminum block locking mechanism. It is adjustable and should be checked to insure that the latch pin (when in down position) will stay locked. This setscrew is adjustable and should be adjusted as needed.
- G. When the latch pin is in the down position, it should secure the nose pin body in the appropriate position for the aircraft it is servicing. (Note: there are two separate positions).
- H. Inspect yoke assembly for worn or damaged parts.
- I. Check tow eye on tow bar for damage and free rotation.
- J. Check tow bar main body tube for bending or cracking.
- K. Check shear pin and bushings for breakage and wear.
- L. Inspect for missing or illegible instruction plaques. Replace as required. See Attachment #1

SECTION IV RENEWAL PARTS TB-980717 TOW BAR ASSEMBLY TOW BAR TO SERVICE DC-9, MD-80, &17 AIRCRAFT

DWG TB-980717-11- YOKE ASSEMBLY

MK#	QTY / UNIT	DESCRIPTION	PART NUMBER
-	1	TB-980717 YOKE ASSEMBLY, COMPLETE	TB-980717-11
1R	1	RIGHT SIDE LATCH KIT	TB-7999-1-R
1L	1	LEFT SIDE LATCH KIT	TB-7999-1-L
1B	2	BUSHING, STRAIGHT	TB-9205-1B
2C	4	FLAT WASHER	TB-9205-2C
3	4	LOCK WASHER	ATR-302F
4	4	MICARTA BOLTS	1L04C0104ZPBG00
5	4	HEX NUT	HN04C0000ZPBG00
6	2	GREASE FITTING	TB-8649-2
7	1	WARNING TAG STEERING with RIVETS	TB-7999-TAG-A
8	1	WARNING PIN REMOVAL TAG with RIVETS	TB-7999-TAG-B
9	2	TWO POSITION PIN TAG with RIVETS	TB-7999-TAG-C
10	1	CAUTION WHEEL TAG with RIVETS	TB-7999-TAG-D
11A	1	YOKE ASSEMBLY W/ BUSHINGS (LESS ATTACHING Parts)	TB-980717-11A
12	2	INSERT, AXLE PIN	TB-9205-8
13	2	ROLL PIN	P443200445S0000
14	2	ROLL PIN HANDLE	P443601125S0000
15	2	NOSE PIN ASSEMBLY COMPLETE (INCL. 12,13,14,15-MKA)	TB-980717-15
15-MKA		NOSE PIN BODY	TB-980717-15-MKA
16	2	MICARTA SKID PADS	TB-980717-16
17	2	PLAQUE; LATCH PIN TAG with RIVETS	TB-980717-TAG

SECTION IV RENEWAL PARTS TB-980717 TOW BAR ASSEMBLY TOW BAR TO SERVICE DC-9, MD-80, &17 AIRCRAFT

MK#Q	TY / UN	IT DESCRIPTION	PART NUMBER
12	1	TB-980717 TOW BAR BODY ASSEMBLY, COMPLETE	TB-980717-12
1	1	PIVOT BOLT	TB-980717-1
1A	2	BUSHING, FLANGED	TB-980717-1A
1A2	2	BUSHING, FLANGED	TB-9205-1A
1D	1	NYLOCK, HALF NUT	TB-980717-1D
2	1	SHEAR BOLT	TB-980717-2
1D2	1	STOVER LOCK NUT	TB-9205-1D
3	1	CAPTURE BOLT	TB-9205-3
3B	1	LOCKNUT	TB-9205-3B
4	1	SWIVEL EYE BUSHING	TB-980717-12K
5	1	TOW EYE RETAINER	TB-980717-12L
6 7	4	BOLT, SWIVEL EYE BUSHING	H508C0032ZP0000
7	4	NORD LOCK WASHER, SWIVEL EYE BUSHING	TB-8898-17-LW
8	1	HOSE HANDLE	TB-980717-12M
9	1	OVER TORQUE TAG with RIVETS	TB-8312-BA-TAG
10	1	TOW EYE	TB-980717-12H
12A	1	TOW BAR BODY W/ BUSHINGS (LESS ATTACHING PAR	•
13	1	WHEEL CARRIAGE ASSEMBLY	TB-980717-13
		(INCL. 13A,13E,14,15,16,17,18)	
13A	1	WHEEL CARRIAGE WELDMENT	TB-980717-13A
13E	2	U-BOLT	TB-980717-13E
14	4	LOCK NUT	TB-8898-6
15	4	NORD LOCK WASHER	TB-8649-4
16	2	PNEUMATIC WHEEL	TB-8714-40
17	4	FLAT WASHER	TB-8714-35
18	2	COTTER PIN	TB-8714-28

Attachment # 1

PART NUMBER TB-7999-TAG A

WARNING

STEERING VALVE MUST BE <u>OPEN</u>
PRIOR TO TOWING AIRCRAFT

PART NUMBER TB-7999-TAG B

WARNING-BEFORE LOCKPIN REMOVAL

CLEAR NOSEWHEEL AREA OF PERSONNEL AND TOWBAR

PART NUMBER TB-7999-TAG C

CAUTION TWO POSITION PINS

1 YELLOW BAND - WITHOUT SPRAY DEFLECTOR 2 YELLOW BANDS - WITH SPRAY DEFLECTOR

PART NUMBER TB-7999-TAG D

CAUTION


AVOID WHEEL DAMAGE
RETRACT PINS FULLY
WHEN REMOVING TOWBAR

PART NUMBER TB-980717-TAG

WARNING: BEFORE TOWING THE LATCH PIN HANDLE NEEDS TO BE IN THE DOWN POSITION


PART NUMBER TB-8312-BA-TAG


DO NOT OVER TORQUE BOLTS SHOULD ROTATE FREELY WITH WRENCH

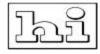

HALL INDUSTRIES, Inc.
PHONE: 724-752--2000 FAX: 724-758--1558

Rev. 07/16/01

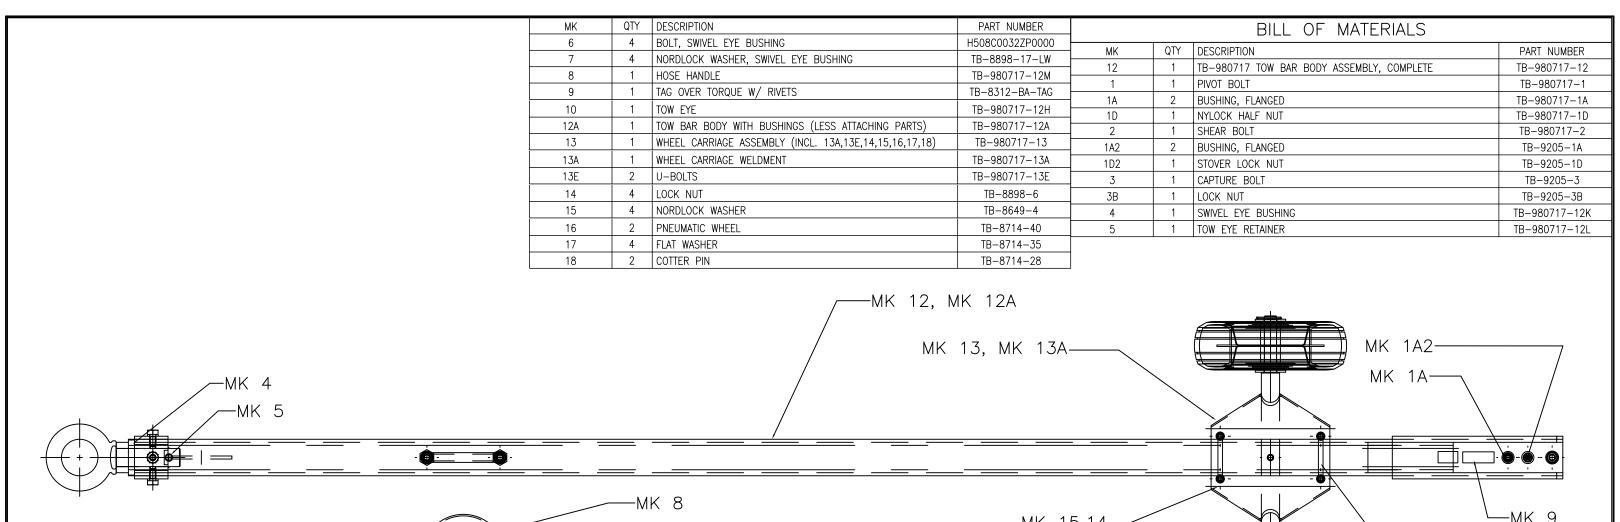

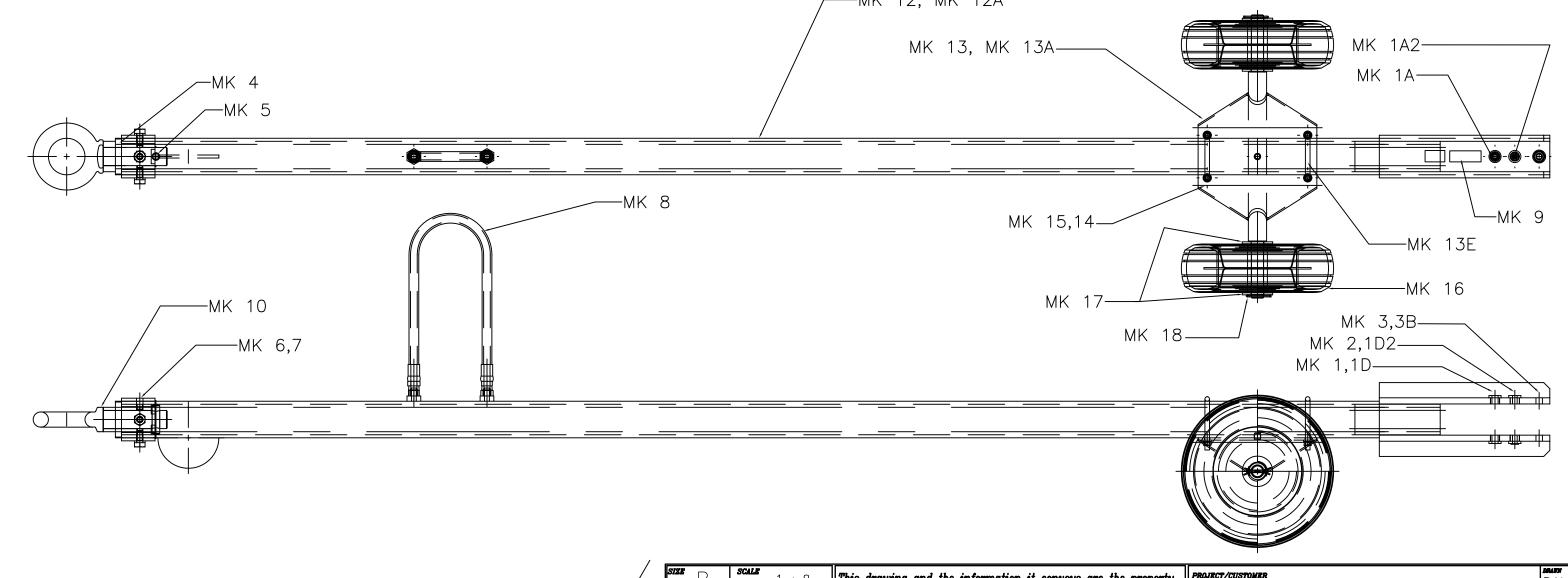

DO NOT SCALE X<12 ±1/32 X ±.050


TOLERANCES UNLESS SPEC OTHERWISE FRACTIONAL DECIMAL ANGULAR $\times 12 \pm 1/16 \times \times \pm .050$ This drawing and the information it conveys are the property of Hall Industries, Inc. It shall not be reproduced in whole or in part, nor submitted to outside parties without the written consent of Hall Industries, Inc. This disclosed information is proprietary and confidential, and shall not be used in any means detrimental to Hall Industries, Inc.

1	PROJECT/CUSTOMER		DALLOS
I	TE	3–980717	
	SUBJECT TO	DW BAR BODY ASSEMBLY	REV 7

	XXX ±.005
REFERENCE DRAWING NO.'S	PROTOTYPE MADE BY CHECKED BY
TB-980717 TB-980717-12K	RELEASED FOR PRODUCTION
TB-980717-12A TB-980717-12L	NOTES
TB-980717-12H TB-980717-13	WARNING !!! DRAWING IS VOID IF BLOCK ABOVE IS NOT COMPLETED !!!

l			······································			
	SYM	DATE	REVISIONS DESCRIPTION	BY	СНК	
1	Λ	04/27/01	ADDED TAGS, UPDATED BOM	BD		L
1	2	07/20/01	UPDATED BOM	BD		2
1						M

Telson of the second of the se		DUSTRIES, son st. pittsbu	Inc.
COMPUTER CODE TB-9	80717–12		
DATE 04/10/01	CHECK WS	DTG.NO. TB-9807	717-12

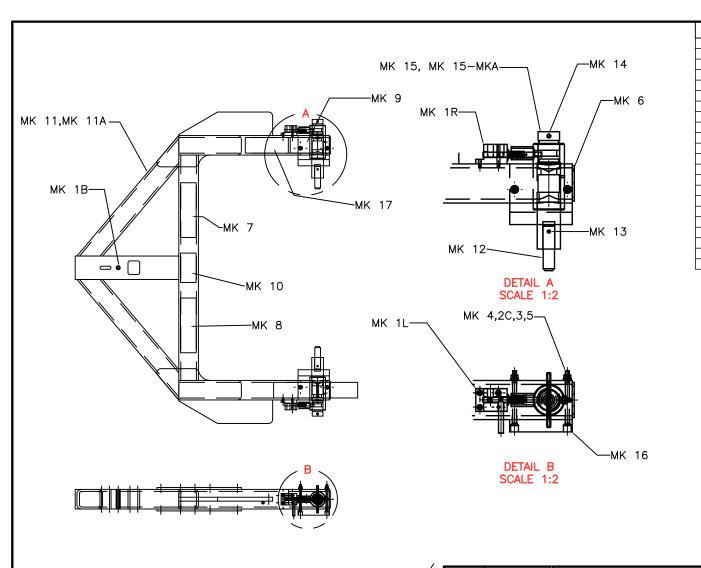

BILL OF MATERIALS				
MK	QTY	DESCRIPTION	PART NUMBER	
-	1	TB-980717 YOKE ASSEMBLY, COMPLETE	TB-980717-11	
1R	1	RIGHT SIDE LATCH KIT	TB-7999-1-R	
1L	1	LEFT SIDE LATCH KIT	TB-7999-1-L	
1B	2	BUSHING, STRAIGHT	TB-9205-1B	
2C	4	FLAT WASHER	TB-9205-2C	
3	4	LOCK WASHER	ATR-302F	
4	4	MICARTA BOLTS	1L04C0104ZP0000	
5	4	HEX NUT	HN04C0000ZPBG00	
6	2	GREASE FITTING	TB-8649-2	
7	1	WARNING TAG STEERING W/RIVETS	TB-7999-TAG-A	
8	1	WARNING PIN REMOVAL W/RIVETS	TB-7999-TAG-B	
9	2	TWO POSITION PIN W/RIVETS	TB-7999-TAG-C	
10	1	CAUTION WHEEL W/RIVETS	TB-7999-TAG-D	
11A	1	YOKE ASSEMBLY WITH BUSHINGS (LESS ATTACHING PARTS)	TB-980717-11A	
12	2	INSERT, AXLE PIN	TB-9205-8	
13	2	ROLL PIN	P443200445S0000	
14	2	ROLL PIN HANDLE	P443601125S0000	
15	2	NOSE PINE ASSEMBLY COMPLETE (INCL. 12,13,14,15-MKA)	TB-980717-15	
15-MKA	2	NOSE PIN BODY	TB-980717-15-MKA	
16	2	MICARTA SKID PADS	TB-980717-16	
17	2	PLAQUE; LATCH PIN W/RIVETS	TB-980717-TAG	

This drawing and the information it conveys are the propert of Hall Industries, Inc. It shall not be reproduced in whole in part, nor submitted to outside parties without the written consent of Hall Industries, Inc. This disclosed information is proprietary and confidential, and shall not be used in any

BOJECT/CUSTOMER		DALLOS
	TB-980717	
US/SCT	YOKE ASSEMBLY	REV ?

	REFERENCE DRAWING NO.	'S	PROTOTYPE MADE BY CHECKED BY	snu	MIR	REVISIONS DESCRIPTION	BY		TE HALL INDUSTRIES, Inc.
TB-	·980717-11A		RELEASED FOR PRODUCTION	Λ	04/26/01	ADDED TAGS, UPDATED BOM	BD		2123 201 EAST CARSON ST. PITTSBURGH, PENN. 152
TB-	-980717-15		NOTES	Δ	07/20/01	UPDATED BOM	BD		
TB-	-980717-16		WARNING M. DRAWING IS VOID IP BLOCK ABOVE IS NOT COMPLETED M.					ALTE	04/10/01 WS TB-980717-11